


of the spirit level between the two center marks on the vial of the level located on the top of the vertical alignment tool.

10. Depress the center release button of the special tool to release the suction cup from the sensor lens and remove the special tool from the sensor.

11. On domestic market vehicles only, reinstall the front fascia onto the vehicle. ([Refer to 13 - Frame and Bumpers/Bumpers/FASCIA, Front - Installation](#)).

12. Perform the ACC sensor horizontal alignment using a diagnostic scan tool and the appropriate diagnostic information.

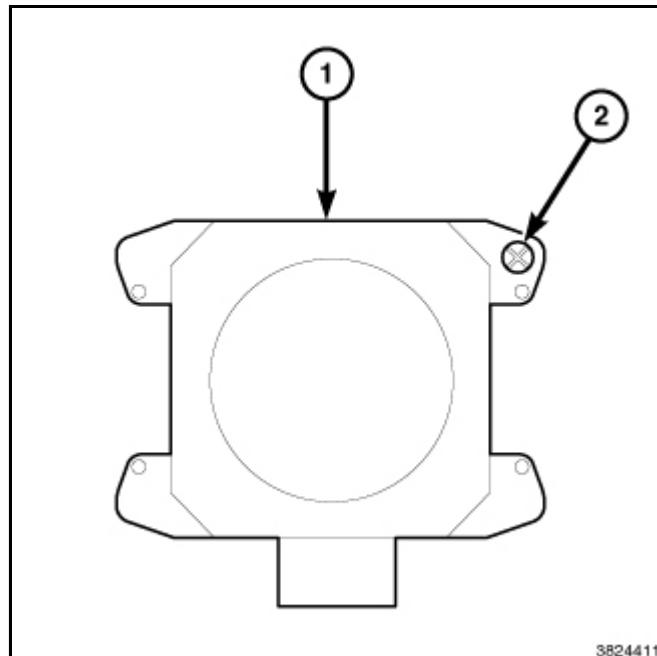

3824411

13. Reinstall the smaller plastic bezel (mirror cover) onto the front of the sensor housing. Care must be taken to orient the bezel properly to ensure proper retention.

14. Reinstall the molded plastic ACC fascia closeout bezel into the right lower air intake opening of the front fascia.